
Version 1.34

(03.01.2017)

Installation instruction
FISCON Bluetooth
Hands free kit
Audi

Article-ID 36429
 36430
 36430-1
 36431
 36431-1

Content

General advice	2
Safety Instructions	3
References of legal regulations for operation	3
FISCON hands free	4
Installation Instruction A3(8P), A4(8E), A6(4B), TT(8J)	5
Note for vehicles fitted with navigation BNS 4.x	6
Microphone	6
Coding VAS	7
Installation instruction A4 (8K), A5, Q5	11
Coding VAS A4(8K), A5 (8T), Q5 (8R)	13
Control elements	17
FISCON menu	18
Operation instruction „Basic Plus“	19
Interface - Diagnostic	27
FAQ	28

Hereby, Kufatec GmbH & Co. KG declares that the Device KUFATEC FISCON are in compliance with the essential requirements and other relevant provisions of Directive 1999/5/EG

The declaration of conformity can be found at the following address: www.kufatec.de/ce

General advice

While developing this product, your personal safety combined with the best operating service, modern design and an up-to-date production technique was especially taken into account.

Unfortunately, despite the utmost care injuries and/or damages might occur due to improper installation and/or use.

Please read the attached instruction manual completely with great care and keep it!

All articles of our production line pass through a 100 % check - for your safety and security.

We reserve the right to carry out technical changes which serve the improvement at any time.

According to each article and purpose, it is sometimes necessary to check each country's legal regulations before installing and starting the unit.

In case of guarantee claims, the device has to be sent back to the seller in the original packaging with the attached bill of purchase and detailed defect's description. Please pay attention to the manufacturer's return

requirements (RMA). The legal warranty directions are valid.

The guarantee claim as well as the operating permission becomes invalid due to:

- a) unauthorized changes to the device or accessories which have not been approved or carried out by the manufacturer or its partners*
- b) opening the device's frame*
- c) device's repairs carried out by one's own*
- d) improper use / operation*
- e) brute force to the device (drop, wilful damage, accident etc.)*

During installation, please pay attention to all safety relevant and legal directions. The device has only to be installed by trained personnel or similarly qualified people.

Please limit on installation or function problems the troubleshooting to 0.5 hours for mechanical and 1.0 hours for electronic works.

To avoid unnecessary work and to save costs, please send us immediately via the contact form Kufatec (<http://www.kufatec.de/shop/de/infocenter/>) a request to our technical support.

Please quote the following necessarily:

- Vehicle Identification Number
- Part number of the retrofit kit
- Detailed description of problems
- Already conducted operations

Safety Instructions

Installation requires special knowledge.

Do not install the unit yourself. For safe and reliable installation, consult a dealer having special knowledge.

- *Never use bolts or nuts from the car's safety devices for installation. If bolts or nuts from the steering wheel, brakes or other safety devices are used for installation of the unit, it may cause an accident.*
- *Use the unit with a DC 12V negative ground car. This unit cannot be used in large trucks which use a DC 24V battery. If it is used with a DC 24V battery, it may cause a fire or accident.*
- *Avoid installing the unit in following places: - Where it would hinder your safe driving. - Where it could damage the car's fittings.*
- *This unit is only for use in the following vehicles. Only connections described within this instruction guide are allowed or required to use for installation.*
- *For damage impact caused by faulty installation, unsuitable connections in appropriate vehicles Kufatec GmbH assumes no liability.*
- *We advise you that these units process data out of the MOST - protocol from the vehicle. As the supplier of this device we don't know the overall system you are working with. If our device causes damage due to other changes made by to the vehicle Kufatec GmbH assumes no liability.*
- *Kufatec GmbH supplier do not guaranty the use of the product for changing's within a new vehicle series.*
- *If the car manufacturer's don't agree with the installation of our device by reason of warranty the Kufatec GmbH assumes no liability. Please check conditions and warranty before you begin the installation.*
- *Kufatec GmbH supplier reserves the right to change the device specifications without notice.*

NOTE: The road traffic has to have your full attention.

Telephone operations should only be done by suitable traffic and weather situations. The volume need to be set that you are still able to realise acoustic warn signals (Police, fire brigade).

- *Errors and changes excepted.*

References of legal regulations for operation

Only use this unit in the intended domain.

If you use it in a foreign domain, if the unit is not installed properly, or if the unit will be reconstructed, the guarantee will expire.

FISCON hands free

- **OEM-menu driven** operation:
 - Radio Concert, Symphony (A4 8K, A5 8T, A5 8F, Q5 8R)
 - Navigation RNS-E, BNS 5.0 (Only Basic-Plus)
 - Multifunctional steering wheel (if available)
- **A2DP Audiostreaming** in order to transfer music to the Infotainment system of the vehicle
- **Microphone adjustment** in order to optimize the voice quality
- **Volume control** regarding A2DP, Conversation, Ring tone
- Unlimited **Software** Updates
- Use of the following telephone **operations**:
 - Access to the **phonebook** (depends on mobile phone, display through the cluster)
 - Placing, answering as well as ending calls
 - Volume control
- **FISCON diagnostic access** – Checking interface information as well as completing a RESET

Scope of delivery

Bluetooth Interface
Wiring
Microphone

NOTE: Before installing the FISCON system you need to check whether the car is retrofitted with a video interface not developed by Kufatec. In case a non-Kufatec video interface is fitted we are not able to guaranty the absolute operation of the FISCON system. You may need to remove the non-Kufatec video interface.

In order to achieve a proper communication you need to keep installation sequence as follows:

Vehicle >>> FISCON >>> Multimedia (Multimedia Adapter, TV in motion)

FISCON system can be used in combination with the Kufatec Multimedia Adapter (from SW 2.53).

Installation Instruction A3(8P), A4(8E), A6(4B), TT(8J)

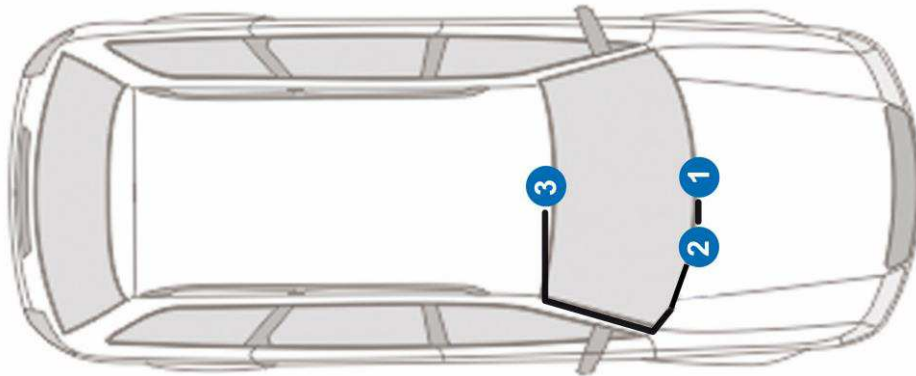


Fig.1

1 – Head unit 2 – Telephone Interface (location can be different) 3 – Microphone

NOTE: The location of the telephone interface can be different within the vehicle. Important in the positioning is that the telephone interface is installed as far as possible away from the driver or mobile phone. If not, it could be that there will be background noises.

Remove the head unit using suitable tools (Fig. 2). Depending on the haed unit (Radio/ Navigation) additional screws needs to be removed.




Fig.2



Fig.3


With a Plug & Play connection you will complete the fitting.

Quadlock

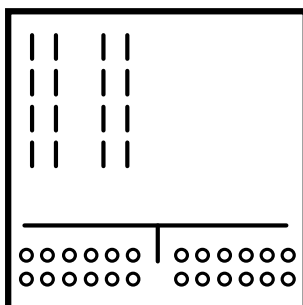

Chorus III
 Concert III
 Symphony III
 BNS 5.0
 RNS-E

ISO



Chorus II
 Concert II
 Symphony II

Note for vehicles fitted with navigation BNS 4.x

In case of factory fitted navigation BNS 4.X the looms for TEL+, TEL- as well as mute needs to be connected to the 20-pole connector of the navigation device.

Wire the looms towards the navigation device in the trunk of the vehicle (Fig. 4).

Connection **20-pole Mini-Iso** (Fig. 5).



Fig.4

TEL+ (NF+) – PIN 16
 TEL- (NF-) – PIN 19
 TEL Mute – PIN 17



Fig.5

Microphone

NOTE: Does the vehicle have airbags fitted along the A-column it is essential to wire the loom for the microphone **BEHIND** the airbag. Wire the loom without putting tension on it. Mount the loom without affecting the airbag in its functionality.

Remove the airbag sign by using suitable tools (in order to avoid damages) and loose the screw located behind (Fig. 7). Start wiring the loom towards the interior light (Fig. 8).



Fig.6



Fig.7

Angle the microphone towards the driver position (Fig. 9).



Fig.8



Fig.9

Coding VAS

In order to code the vehicle system you need to choose the **Self-Diagnosis**. Please complete the coding step by step as shown on images below.

For Navigation Audi RNS-E, Seat media system 6,5" Address 56 xxx7xx For US version it has to become 6

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose	
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	

Vehicle Self-Diagnosis



Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	
6C - Rückfahrkamera	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	

Address 56 Radio



Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
001 - Identifikation (Dienst \$1A)	
004 - Fehlerspeicherung	
008 - Codierung (Dienst \$)	
011 - Messwerte	
014 - Lange Anpassung	
015 - Zugriffsberechtigung	
017 - Sicherheit	
022 - Ausgabe beenden	
Alle Diagnosefunktionen anzeigen	

Coding



Fahrzeug-Eigendiagnose	56 - Radio (CAN)8T0
007 - Codierung	RNS-E PU EU H05
Codierwert eingeben	Codierung xxxxxx
max. Eingabewert =	Betriebsnummer

Enter value xxx7xx - confirmation



After coding an RNS-E Reset needs to be completed

After coding you need to complete a **RESET** of the headunit RNS-E. Please turn the device off. By turning on the head unit again please keep the button (around 45 Sec) until the head unit will re-start again.



By turning on the headunit please keep the button until the headunit will re-start again.

The head unit need to have a software index of at least 350.

For Navigation Audi BNS 5.0, Seat media system 1.0
Address 56 xx?xxx +02 (add 2)

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose ←	
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtwertenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio ←	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	
6C - Rückfahrkamera	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	

Vehicle Self-Diagnosis ➡

Address 56 Radio ➡

Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
001 - Identifikation (Dienst \$1A)	
004 - Fehlerspeicherinhalt	
008 - Codierung (Dienst \$) ←	
011 - Messwerte	
014 - Lange Anpassung	
015 - Zugriffsberechtigung	
017 - Sicherheit	
022 - Ausgabe beenden	
Alle Diagnosefunktionen anzeigen	

Fahrzeug-Eigendiagnose	56 - Radio (CAN)8T0
007 - Codierung	RNS-E PU EU H05
Codierwert eingeben	Codierung xxxxxx
max. Eingabewert =	Betriebsnummer

1 2 3
4 5 6
7 8 9
C 0 Q

Coding ➡

Add 2 to the current value: xx?xxx ➡

For Radio Concert III/ Symphony III, Seat Adaggio
Address 56 ?xxxxx +04 (add 4)

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose ←	
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtwertenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio ←	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	
6C - Rückfahrkamera	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	

Vehicle Self-Diagnosis ➡

Address 56 Radio ➡



Coding



Add 2 to the current value: ?xxxx - confirmation



ADDITIONAL Coding Address 17 (Instrument cluster)

ONLY for Audi A4 8E

A6 4B

A8 4D

Seat Exeo

Channel 62 - +02 (add 2)

ADDITIONAL Coding Address 16 (Steering wheel) – In case multifunctional steering wheel is not available coding is not needed!

For Audi A4 8E	02xxx	-	to 03xxx
A6 4B	0xxx2	-	to 0xxx1
A8 4D	0xxx2	-	to 0xxx1
A3 8P	02xxx	-	to 03xxx
TT 8J	02xxx	-	to 03xxx
Seat Exeo	02xxx	-	to 03xxx

ADDITIONAL Coding Address 19 – CAN Gateway ONLY for Audi A3 8P TT 8J

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose ←	
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	
<div style="display: flex; justify-content: space-around; width: 100%;"> ◀ ▶ ▶▶ </div>	

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	
19 - Diagnoseinterface für Datenbus ←	
<div style="display: flex; justify-content: space-around; width: 100%;"> ◀ ▶ ▶▶ </div>	

Vehicle Self-Diagnosis

Address 19 CAN Gateway

Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
001 - Identifikation (Dienst \$1A)	
004 - Fehlerspeicherung	
008 - Codierung (Dienst \$) ←	
011 - Messwerte	
014 - Lange Anpassung	
015 - Zugriffsberechtigung	
017 - Sicherheit	
022 - Ausgabe beenden	
Alle Diagnosefunktionen anzeigen	
<div style="display: flex; justify-content: space-around; width: 100%;"> ◀ ▶ ▶▶ </div>	

Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
008.01 - Codierung	
008.02 - Codierung Verbauliste ←	
<div style="display: flex; justify-content: space-around; width: 100%;"> ◀ ▶ ▶▶ </div>	

Coding

Component list

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon ←	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	
19 - Diagnoseinterface für Datenbus	
<div style="display: flex; justify-content: space-around; width: 100%;"> ◀ ▶ ▶▶ </div>	

Telephone from „not coded“ --- to --- „coded“ - confirmation

Installation instruction A4 (8K), A5, Q5

Please remove the cover of the display by using suitable tools in order to avoid damages (Fig. 10). Disconnect the connection for airbag.

Please remove the vent (Fig. 11) as well as the climate control (Fig. 12) by using suitable tools.



Fig.10



Fig.11

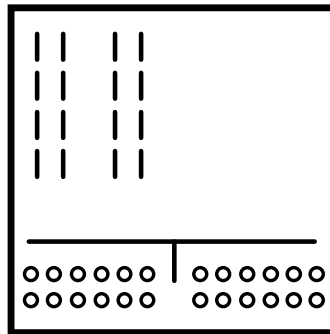


Fig.12

Loose the 4 screws of the head unit and remove it. After removing disconnect the wiring.

With a plug & play connection you will complete the fitting of the hands free kit.

Quadlock



NOTE: Important in the positioning is that the telephone interface is installed as far as possible away from the driver or mobile phone. If not, it could be that there will be background noises.

Loosen the necessary screws of the glove box (Fig. 13 - 15).



Fig.13



Fig.14



Fig.15

Remove the airbag sign by using suitable tools (in order to avoid damages) and loose the screw located behind (Fig. 16).

Start wiring the loom towards the interior light.



Fig.16



Fig.17



Fig.18

NOTE: Does the vehicle have airbags fitted along the A-column it is essential to wire the loom for the microphone **BEHIND** the airbag. Wire the loom without putting tension on it. Mount the loom without affecting the airbag in its functionality.

Open the storage of the interior light and loose the screw (Fig. 19). Mount the microphone on the original location within the interior light – driver's side (Fig. 21).



Fig.19



Fig.20

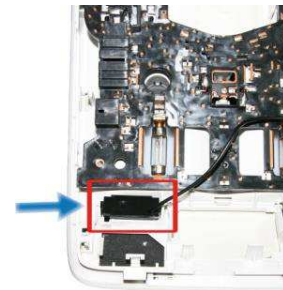


Fig.21

Coding VAS A4(8K), A5 (8T), Q5 (8R)

In order to code the vehicle system you need to choose the **Self-Diagnosis**. Please complete the coding step by step as shown on images below.

Address 19 CAN Gateway set Telephone to „coded“

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose ←	
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	
◀ ▶	

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	
19 - Diagnoseinterface für Datenbus ←	
◀ ▶	

Vehicle Self-Diagnosis

Address 19 CAN Gateway

Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
001 - Identifikation (Dienst \$1A)	
004 - Fehlerspeicherinhalt	
008 - Codierung (Dienst \$) ←	
011 - Messwerte	
014 - Lange Anpassung	
015 - Zugriffsberechtigung	
017 - Sicherheit	
022 - Ausgabe beenden	
Alle Diagnosefunktionen anzeigen	
◀ ▶	

Fahrzeug-Eigendiagnose	19 - Diagnoseinterface für Datenbus
Unterstützte Funktionen	Interfacebox
Diagnosefunktion auswählen	Codierung 1
	Betriebsnummer
008.01 - Codierung	
008.02 - Codierung Verbauliste ←	
◀ ▶	

Coding

Component list

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon ←	
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	
19 - Diagnoseinterface für Datenbus	
◀ ▶	

Telephone from „not coded“ --- to --- „coded“ - confirmation

Address 56 Radio Byte 3 Value 1000010

Fahrzeug-Eigendiagnose
Fahrzeugsystem auswählen
55 - Leuchtweitenregulierung 5C - Spurassistent 16 - Lenkradelektronik 46 - Zentralverriegelung Komfortsystem 56 - Radio 10 - Einparkhilfe II 07 - Anzeige-/ Bedieneinheit 17 - Schalttafelersatz 37 - Navigation 47 - Soundsystem 77 - Telefon 0E - Mediaplayer Position 1 08 - Klima-/Heizungselektronik 09 - Elektronische Zentralelektrik
◀ ▶ ▶

Fahrzeug-Eigendiagnose
Unterstützte Funktionen
Diagnosefunktion auswählen
001 - Identifikation (Dienst \$1A) 004 - Fehlerspeicherinhalt 008 - Codierung (Dienst \$) 011 - Messwerte 012 - Anpassung 015 - Zugriffsberechtigung 017 - Sicherheit 022 - Ausgabe beenden Alle Diagnosefunktionen anzeigen
◀ ▶ ▶

Address 56 Radio →

Coding →

Master →

Fahrzeug-Eigendiagnose
008 - Codierung
Byte Index Hex Bit-Muster
0
1
2
3 1000010
4
1 2 3 4 5 6 7 8 9 C 0 Q HEX BIN
◀ ▶ ▶

Zählmethode:

7	6	5	4	3	2	1	0
0	0	0	0	0	0	0	0
↑							↑
Bit 7							Bit 0

Select BIN

Enter value 1000010 - confirmation


Adresse 56 Radio Adaptation

NOTE: This setting on the channel, only applies for the following vehicles:


- Audi A4 8K from Modelyear 2013
- Audi A8 8T from Modelyear 2013
- Audi Q5 8R from Modelyear 2013

Go to the address 56 and select the **adaptation**. There, look for the **channel 36** and edit it. Here you change the value (usually in the above configuration, this value is 15) to **255** and confirm it.

Search also for the **channel 37** and edit it. Here you change the value (usually in the above configuration, this value is 15) also to **255** and confirm it.

Fahrzeug-Eigendiagnose
Fahrzeugsystem auswählen
55 - Leuchtweitenregulierung 5C - Spurassistent 16 - Lenkradelektronik 46 - Zentralmodul Komfortsystem 56 - Radio 10 - Einparkhilfe II 07 - Anzeige-/ Bedieneinheit 17 - Schalttafeleinsatz 37 - Navigation 47 - Soundsystem 77 - Telefon 0E - Mediaplayer Position 1 08 - Klima-/Heizungselektronik 09 - Elektronische Zentralelektrik


Address 56 Radio 

Fahrzeug-Eigendiagnose
Unterstützte Funktionen
Diagnosefunktion auswählen
001 - Identifikation (Dienst \$1A) 004 - Fehlerspeicherinhalt 008 - Codierung (Dienst \$) 011 - Messwerte 012 - Anpassung 015 - Zugriffsberechtigung 017 - Sicherheit 022 - Ausgabe beenden Alle Diagnosefunktionen anzeigen


Adaptation 

Channel 36 + 37 

Address 47 Soundsystem

Only for vehicles with Audi Sound System or Bang & Olufsen.

Byte 0 - Bit 0 to 1 xxxxxxx1

<table border="1"> <tr><th>Fahrzeug-Eigendiagnose</th></tr> <tr><td>Fahrzeugsystem auswählen</td></tr> <tr><td>55 - Leuchtweitenregulierung 5C - Spurassistent 16 - Lenkradelektronik 46 - Zentralmodul Komfortsystem 56 - Radio 10 - Einparkhilfe II 07 - Anzeige-/ Bedieneinheit 17 - Schalttafelersatz 37 - Navigation 47 - Soundsystem 77 - Telefon 0E - Mediaplayer Position 1 08 - Klima-/Heizungselektronik 09 - Elektronische Zentralelektrik</td></tr> <tr><td>◀ ▶ ▶</td></tr> </table>	Fahrzeug-Eigendiagnose	Fahrzeugsystem auswählen	55 - Leuchtweitenregulierung 5C - Spurassistent 16 - Lenkradelektronik 46 - Zentralmodul Komfortsystem 56 - Radio 10 - Einparkhilfe II 07 - Anzeige-/ Bedieneinheit 17 - Schalttafelersatz 37 - Navigation 47 - Soundsystem 77 - Telefon 0E - Mediaplayer Position 1 08 - Klima-/Heizungselektronik 09 - Elektronische Zentralelektrik	◀ ▶ ▶	<table border="1"> <tr><th>Fahrzeug-Eigendiagnose</th></tr> <tr><th>Unterstützte Funktionen</th></tr> <tr><td>Diagnosefunktion auswählen</td></tr> <tr><td>001 - Identifikation (Dienst \$1A) 004 - Fehlerspeicherinhalt 008 - Codierung (Dienst \$) 011 - Messwerte 012 - Anpassung 015 - Zugriffsberechtigung 017 - Sicherheit 022 - Ausgabe beenden Alle Diagnosefunktionen anzeigen</td></tr> <tr><td>◀ ▶ ▶</td></tr> </table>	Fahrzeug-Eigendiagnose	Unterstützte Funktionen	Diagnosefunktion auswählen	001 - Identifikation (Dienst \$1A) 004 - Fehlerspeicherinhalt 008 - Codierung (Dienst \$) 011 - Messwerte 012 - Anpassung 015 - Zugriffsberechtigung 017 - Sicherheit 022 - Ausgabe beenden Alle Diagnosefunktionen anzeigen	◀ ▶ ▶
Fahrzeug-Eigendiagnose										
Fahrzeugsystem auswählen										
55 - Leuchtweitenregulierung 5C - Spurassistent 16 - Lenkradelektronik 46 - Zentralmodul Komfortsystem 56 - Radio 10 - Einparkhilfe II 07 - Anzeige-/ Bedieneinheit 17 - Schalttafelersatz 37 - Navigation 47 - Soundsystem 77 - Telefon 0E - Mediaplayer Position 1 08 - Klima-/Heizungselektronik 09 - Elektronische Zentralelektrik										
◀ ▶ ▶										
Fahrzeug-Eigendiagnose										
Unterstützte Funktionen										
Diagnosefunktion auswählen										
001 - Identifikation (Dienst \$1A) 004 - Fehlerspeicherinhalt 008 - Codierung (Dienst \$) 011 - Messwerte 012 - Anpassung 015 - Zugriffsberechtigung 017 - Sicherheit 022 - Ausgabe beenden Alle Diagnosefunktionen anzeigen										
◀ ▶ ▶										

Address 56 Radio →

Coding →

Master →

<table border="1"> <tr><th>Fahrzeug-Eigendiagnose</th></tr> <tr><th>008 - Codierung</th></tr> <tr><td>Byte Index Hex Bit-Muster 0 xxxxxxx1 1 2 3 4</td></tr> <tr><td>1 2 3 4 5 6 7 8 9 C 0 Q</td></tr> <tr><td>HEX BIN</td></tr> <tr><td>◀ ▶ ▶</td></tr> </table>	Fahrzeug-Eigendiagnose	008 - Codierung	Byte Index Hex Bit-Muster 0 xxxxxxx1 1 2 3 4	1 2 3 4 5 6 7 8 9 C 0 Q	HEX BIN	◀ ▶ ▶	<table border="1"> <tr><th>Fahrzeug-Eigendiagnose</th></tr> <tr><th>008 - Codierung</th></tr> <tr><td>Byte Index Hex Bit-Muster 0 xxxxxx0x 1 2 3 4</td></tr> <tr><td>1 2 3 4 5 6 7 8 9 C 0 Q</td></tr> <tr><td>HEX BIN</td></tr> <tr><td>◀ ▶ ▶</td></tr> </table>	Fahrzeug-Eigendiagnose	008 - Codierung	Byte Index Hex Bit-Muster 0 xxxxxx0x 1 2 3 4	1 2 3 4 5 6 7 8 9 C 0 Q	HEX BIN	◀ ▶ ▶
Fahrzeug-Eigendiagnose													
008 - Codierung													
Byte Index Hex Bit-Muster 0 xxxxxxx1 1 2 3 4													
1 2 3 4 5 6 7 8 9 C 0 Q													
HEX BIN													
◀ ▶ ▶													
Fahrzeug-Eigendiagnose													
008 - Codierung													
Byte Index Hex Bit-Muster 0 xxxxxx0x 1 2 3 4													
1 2 3 4 5 6 7 8 9 C 0 Q													
HEX BIN													
◀ ▶ ▶													

Select BIN Enter value – confirmation

Byte 0 - Bit 1 to 0 xxxxxx0x

Additional change of address 47

Only for cars with Audi and Bang & Olufsen sound system.

Please also change the long coding as presented below:

0203010101 → 0203010102 (The last byte must be 02)

Control elements

Multifunctional steering wheel (A3 8P, A4 B7, A4 8K, A5 8T, Q5 8R)

By pushing the **MODE** button on MFSW you will reach the menu of the hands free. By using the **SCROLL** you will select the single options as well as complete the different settings.



Fig.22

Multifunctional steering wheel (A4 B6, A6 4B, A8 4D)

By pushing the „<“ - button you will reach the phone menu. By using the arrow buttons „^“ - „v“ you will choose the single options. By using the „>“ - button you will confirm the single selections. In order to leave the menu please select the button „<“.

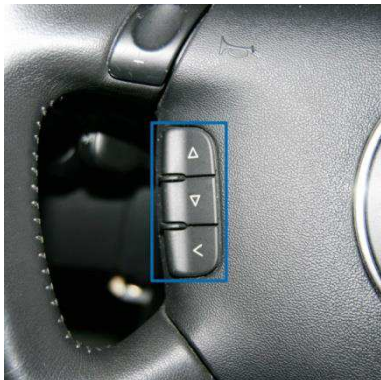


Fig.23



Fig.24

Driver Information System

The menu will be displayed within the DIS of the vehicle.

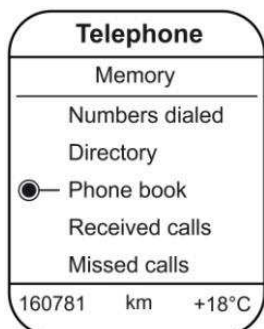


Fig.25

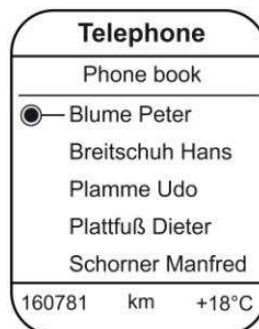


Fig.26

FISCON menu

(Limited for A4 8K, A5 8T, A5 8F, Q5 8R)

PHONEBOOK



DIALLED NUMBERS



ACCEPTED CALLS



MISSED CALLS

Display DIS	Description
PHONEBOOK	Access to the phonebook of the mobile phone. The phonebook feature is not supported by all mobile phones. Does your mobile phone support the phonebook feature you will have access to the phonebook. Phonebooks that have a large number of entries can take quite a long time to synchronise. Please avoid cancelations during synchronisation. The phonebook feature is limited to 1000 phonebook entries.
DIALLED NUMBERS	By choosing the menu DIALLED NUMBERS you are able to select these telephone numbers you dialled before (if supported from mobile phone).
ACCEPTED CALLS	By choosing the menu ACCEPTED CALLS you are able to select these telephone numbers you accepted before (if supported from mobile phone).
MISSED CALLS	By choosing the menu MISSED CALLS you are able to select these telephone numbers which tried to call you but you didn't accept (if supported from mobile phone).

Operation instruction „Basic Plus“

The following operating instruction is valid for the head unit **RNS-E, BNS 5.0** as well as Radio **Concert, Symphony for Audi A4 8K, A5 8T, A5 8F, Q5 8R** (certain variations in consequence of original operating).

Does the vehicle not have factory fitted hands free Fig. 27 will be displayed by choosing the **TEL** button. Once the installation as well as the coding has been finished and the interface is connected the telephone screen will be displayed (Fig. 28).



Fig.27



Fig.28

Pairing

1. Press the **TEL** button on the head unit
2. Make sure the Bluetooth feature of the mobile is turned on
3. Start the pairing procedure on your mobile phone
4. When prompted for a passkey, enter **1234** on your mobile phone

Once pairing is complete Fig. 29 will appear on the screen of the head unit. You will see the network provider's name as well as the coverage if supported from mobile phone.



Fig.29

Numbers of Bluetooth devices - You may pair up to 5 different mobile phones.

In case of pairing an additional mobile phone (5 mobiles already listed) the system has to be set back to factory settings. Press **SETUP** and follow the steps displayed on Fig. 30.



Fig.30

Phonebook

NOTE: The mobile phone must support phone book sync via Bluetooth to use this feature. The phonebook feature is limited to 1000 phonebook entries (sub-entries included). Phonebooks that have a large number of entries can take quite a long time to synchronise. Please avoid cancelations during synchronisation.

Press **TEL > MEMORY** (Fig.31).

Select a phonebook entry and press the **DIAL** button for placing the call.



Fig.31

Note: By using the scroll - button in a fast way you will step to the next initial letter of the phonebook.

Sorting sequence of phonebook entries Firstname, Lastname OR Lastname, Firstname

NOTE: This feature is saved by mobile phone profile. If another mobile will be paired the following steps needs to be completed again.

This feature is not supported from all mobile phones!

This feature is available fom FISCOON mainboard software 1.94.

Sequence Firstname, Lastname


1. Pair up your Bluetooth phone with the hands free as usual.
2. The phonebook needs to be loaded completely.
3. Enter the following code into your mobile: **258225000**
4. After entering the code please press **DIAL** on the mobile  (Fig. 32)
5. Hang up after 2-3 seconds. The call will be answered with “The number does not exist” but the activation has been completed.



Fig. 32

NOTE: The phone should stay connected for at least 10 minutes after the code is entered (this time depends on how many entries are stored in the phone).

Either the new phonebook will show up automatically OR the new phonebook will show up after next pairing. (This depends on which radio system is installed).

Sequence Lastname, Firstname


1. Pair up your Bluetooth phone with the hands free as usual.
2. The phonebook needs to be loaded completely.
3. Enter the following code into your mobile: **258225001**
4. After entering the code please press **DIAL** on the mobile  (Fig. 33)
5. Hang up after 2-3 seconds. The call will be answered with “The number does not exist” but the activation has been completed.



Fig. 33

NOTE: The phone should stay connected for at least 10 minutes after the code is entered (this time depends on how many entries are stored in the phone).

Either the new phonebook will show up automatically OR the new phonebook will show up after next pairing. (This depends on which radio system is installed)

Sear contact

Press **PHONEBOOK > SEARCH ENTRY** (Fig. 34).
By using the knob you are able to search for contacts



Fig.34

Call lists

Press **TEL > MEMORY > DIALED NUMBERS / ACCEPTED CALLS/ MISSED CALLS**
Select an entry and press the **DIAL** button for placing the call.



Fig.35

NOTE: The mobile phone must support call list sync to use this feature.

Dial plate

Enter the number you would like to dial using the dial plate and press the **DIAL** button for placing the call (Fig. 36).



Fig.36

Incoming calls

An incoming call will cause the radio to mute. The name of the caller (depends on mobile) will be displayed. In case the caller is not stored by name the number will be displayed.

The call can be accepted by selecting **ANSWER** OR rejected by selecting the **REJECT** option.



Fig.37

Answer a second call

In case of receiving a second call during an already started conversation Fig. 38 will appear. By using the knob you are able to switch to the second call as well as ignore the second call.



Fig.38

A2DP Audiostreaming

NOTE: The **A2DP** function has to be **activated** before using.

The mobile phone must support A2DP sync via Bluetooth to use this feature.

A2DP Activation

Please complete the following process:

1. Pair up your Bluetooth phone with the hands free as usual
2. Press the **TEL** button on the MMI panel
3. Enter the following code for activation: **258224001** (**Deactivation - 258224000**)
4. After entering the code please press **DIAL** (Fig. 39)



Fig. 39

NOTE: From FISCON Software Index 1.85 the following Code can also be used: **258224001**. The call will be answered with “The number does not exist” but the activation has been completed.

After activation  **Vehicle system needs to shut down**

NOTE: Please lock the vehicle for about 5 minutes.



The activation can also be completed with the mobile phone

Please enter the code on the mobile and press dial.

NOTE: Condition is that the mobile **transmits the number** to the head unit. In case your mobile doesn't support that feature you need to use a phone which does.

NOTE: On A4 (8K), A5 (8T) and Q5 the A2DP function to be started from the mobile phone. There is no point in the menu FIS.

The Audi radio and navigation devices supports only A2DP in Mono.

Enter Bluetooth PIN

In case you want to change the Bluetooth PIN please press **SETUP** as well as **Telephone settings**. Please complete procedure shown on Fig.40. By using the knob you are able to enter and store a new Bluetooth PIN.



Fig.40

Enter Mailbox number

Press **SETUP** and choose the menu item **Mailbox** number. Now you are able to enter your personal mailbox number (Fig. 42).



Fig.41



Fig.42

FISCON Setup

Interface – settings can also be completed by using your mobile phone.



Fig.43

NOTE: Condition is that the mobile **transmits the number** to the head unit. In case your mobile doesn't support that feature you need to use a phone which does.

Setup

Please complete the following process:

1. Pair up your Bluetooth phone with the hands free as usual
2. Press the **TEL** button on the head unit
3. Enter the following code: **25822XXYY**
4. After entering the code please press **DIAL** (Fig. 44)



Fig.44

Function	XX	YY	Example
Volume telephone	10	(0-15)	258221009
Volume ring tone	11	(0-15)	258221112
Microphone	14	(0-15)	258221409
A2DP Activation	40	01	258224001
A2DP Deactivation	40	00	258224000
Softwareupdate	20	25	258222025
Factory settings	21	77	258222177
Language settings	30	(00-07)	

Language - 30:

00-Vehicle language	01-German	02-English	03-Spanisch
04-Italian	05-French	06-Dutch	07-Portuguese

NOTE: The call will be answered with "The number does not exist" but the activation has been done.

Interface - Diagnostic

By using the original VW diagnostic software **VAS** specific information can be checked as well as a **RESET** of the hands free system can be completed.

Reset processing

Fahrzeug-Eigendiagnose	
Systemauswahl	
Wählen Sie ein System:	
Eigendiagnose	←
Eigendiagnose - Verbundsysteme	
LT2 Eigendiagnose	
Crafter Eigendiagnose	

Vehicle self diagnostic

Fahrzeug-Eigendiagnose	
Fahrzeugsystem auswählen	
55 - Leuchtweitenregulierung	
5C - Spurassistent	
16 - Lenkradelektronik	
46 - Zentralmodul Komfortsystem	
56 - Radio	
10 - Einparkhilfe II	
07 - Anzeige-/ Bedieneinheit	
17 - Schalttafeleinsatz	
37 - Navigation	
47 - Soundsystem	
77 - Telefon	←
0E - Mediaplayer Position 1	
08 - Klima-/Heizungselektronik	
19 - Diagnoseinterface für Datenbus	

Address 77 - Telephone

Fahrzeug-Eigendiagnose	77 - Telefon	KTC 36496P
Unterstützte Funktionen	KTC 36496P	KTC 36496P
Diagnosefunktion auswählen	SWP:3.12.0 H21	000 0185
	Codierung	
	Betriebsnummer	
001 - Identifikation (Dienst \$1A)		
004 - Fehlerspeicherinhalt		
015 - Zugriffsberechtigung	←	
017 - Sicherheit		
022 - Ausgabe beenden		
Alle Diagnosefunktionen anzeigen		

015 - Security access

Fahrzeug-Eigendiagnose	77 - Telefon	KTC 36496P												
015.02 - Security-Access (automatisch)	KTC 36496P	KTC 36496P												
Codewort eingeben	SWP:3.12.0 H21	000 0185												
max. Eingabewert = 99999	Codierung													
	Betriebsnummer													
20577														
<table border="1" style="margin-left: auto; margin-right: auto;"> <tr><td>1</td><td>2</td><td>3</td></tr> <tr><td>4</td><td>5</td><td>6</td></tr> <tr><td>7</td><td>8</td><td>9</td></tr> <tr><td>C</td><td>0</td><td>Q</td></tr> </table>			1	2	3	4	5	6	7	8	9	C	0	Q
1	2	3												
4	5	6												
7	8	9												
C	0	Q												

Value 20577 - Q

Value 20577 --- Q (quit) --- RESET completed

Note: After completing a RESET the Bluetooth connection to the hands free will be canceled.

FAQ

I do not get any connection to the FISCON hands free

- *A number of 5 different mobile phones have already been connected to the FISCON hands free. In order to connect another mobile phone the factory settings has to be activated.*

Why does not pop up the phonebook on the screen of the head unit?

- *The phonebook feature is not supported by all mobile phones.*
- *Phonebooks that have a large number of entries can take quite a long time to synchronise*

I don't have any access to the phone menus like „Dialed numbers“, „Accepted calls“, „Missed calls“.

- *These features are not supported by all mobile phones!*
- *The system need to be coded specific to the radio as well as vehicle.*

The FISCON system won't be accepted by the vehicle.

- *In case a non-Kufatec video interface is fitted we are not able to guaranty the absolute operation of the FISCON system.*
- *Any mobile phone preparations which are communicating with the CAN Bus system of the vehicle have to be removed!*
- *After coding you need to complete a RESET of the head unit RNS-E.*

I'm not able to operate the hands free kit by using the buttons of the head unit RNS-E / BNS 5.0?

- *Operation by using the original buttons of the RNS-E / BNS 5.0 head unit only available with FISCON version „Basic Plus“.*

Why is the DIS changing the display continuously?

- *The vehicle is already equipped with a hands free kit. This hands free kit has to be removed.*

I do not have the guided menu within the cluster?

- *Guided menu through the cluster just available for vehicles with multifunctional steering wheel..*

FAQ – Online

<http://www.kufatec.de/shop/infocenter.php/faq>